







GUIDELINES



Focus the QR Code and download the safety data sheet





GUIDELINES

For correct application and storage of HYBRID

PRELIMINARY INSTRUCTIONS



- 1 Before each application, shake the content of the can;
- 2 Make sure that the surface to be treated is dry and clean from algae, lichens, oils, dust and dirt;
- Protect any plastic components (electrical sockets, PVC frames, blinds, etc.) that may be damaged when in contact with the product;
- 4 Avoid applying the product on rainy days, with temperatures below 5 ° C or above 30 ° C.
- It is recommended that the treated surface is exposed for at least 2 hours to sunlight, therefore avoid applying the product in the late afternoon;
- The product must be applied homogeneously by brush or spray using suitable low pressure equipment;
- The yield of the product depends on the porosity of the substrate and on the correctness of the application.

BRUSH APPLICATION



- A Pour into a bowl only the amount of product that you intend to use immediately, since the exposure to sunlight causes a fast polymerization of the liquid;
- B After the treatment, store the unused product in the original can, in dark, fresh and dry place (storage temperature between 5°C and 30°C)
- Apply HYBRID uniformly over the entire surface to be treated, in one or more passes in one coat; apply an amount that prevents dripping
- In case of dripping, apply immediately the excess product to the surrounding surface using the brush or absorb immediately with a sponge or absorbent cloth.
- Once the application has been completed, clean the brush and tools with soap and water and, finally, with acetone.

SPRAY APPLICATION



- A For spray application of HYBRID, use low pressure electric airless equipment, suitable for painting and equipped with a light-shielded container, or use the electric sprayer COPERNICO Spray;
- After the treatment, store the unused product in the original can, in dark, fresh and dry place (storage temperature between 5°C and 30°C).
- Apply HYBRID uniformly over the entire surface to be treated, in one coat avoiding overlapping; apply an amount that prevents dripping;
- In case of dripping, apply immediately the excess product to the surrounding surface using the brush or absorb immediately with a sponge or absorbent cloth;
- Once the application is complete, empty immediately and rinse the container of the gun with water, then fill it with soap and water and spray away from the treated surface until the gun is completely clean, finally spray away from the treated surface at least one liter of clean water.